

Brew Chamber Glass Error

Indicates that brew chamber is not installed correctly.

Step by step actions:

- 1) Have the attached parts list with you when going to the store
- 2) If possible, at arrival take pictures of the info "i" screen
- 3) Lift locking latch, and remove brew chamber
- 4) Remove and inspect plunger gasket
 - a. If dirty, but in good condition, clean and re-install gasket on the plunger (flat edges of gasket fit into groove on plunger)
 - b. If damaged or worn, replace plunger gasket
- 5) If the problem persists, take brew chamber apart and inspect silicone rings (2) and brew cylinder
 - a. If damaged or worn, replace silicone rings and/or brew cylinder
 - b. If in good condition, re-assemble, install, and lower locking latch
- 6) If error persists, confirm that brew chamber switch is engaging when brew chamber is installed
 - a. If switch is out of position, reposition by adjusting the set screw
 - b. If switch is damaged, replace switch and wire harness (switch leads)
- 7) If problem still persists, call Technical Support (800-5FRANKE)

Truck Stock-Parts		
Parts Number	Description	Quantity
19006258	Gasket, Plunger Seal Profile	1
19006265	Brew Chamber Silicone ring, 80 Shore	2
19006590	Tube, Glass Brew Pipe 4.0 Unit	1
19006509	Switch Leads	1